
	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

Contents

1. Scope	3
2. Applicable standards	3
3. General	3
4. Certification of personnel.....	4
5. Choice of Units.....	4
6. Sensitivity of He detector	5
7. Maximum Acceptance Leak Rates.....	5
8. Scheduling of Leak Tests.....	5
9. Methods and Procedures	6
10. Leak testing Methodologies.....	7
11. Procedure for Helium Leak Tightness and Testing	9
12. Acceptance Criteria.....	16
13. Responsibilities	17
14. Acceptance Leak Testing at the Supplier's Premises.....	17
15. Acceptance Leak Testing at the ITER site.....	17
16. Reporting of Leak Tests.....	17

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

1. Scope

The annexure defines the criteria and gives general guidelines for the leak tightness of DNB Vessel and HNB3 Vessel during various stages of manufacturing and final acceptance tests at factory. This annexure is to be read along with the **Annexure 2_QA, QC, Inspection and testing especially clause no. 5.3.4 Leak Testing**

2. Applicable standards

ITER Vacuum Handbook Appendix 12	Guide to leak testing of components for the ITER Projects.
EN 13185	Non Destructive Testing- Leak Testing Tracer gas
EN 473	Personnel certification for Leak Detection testing

3. General


3.1 leak tests shall be performed:

- During manufacturing to confirm the soundness of joining processes and sub-components and to reduce the risk of Incorporating leaks in a system that are subsequently difficult to locate or to repair.
- As an acceptance test at the supplier's site to show that completed assemblies meet the acceptance leak criteria (See Annexure 2 for the series of leak tests to be performed as a part of Factory Acceptance Tests).
-


3.2 Tests shall be performed both at ambient temperature with the pressure differential in the same direction as for operation of the component. Where possible, component parts shall be tested before assembly. However, final assemblies must also be tested.

3.3 Supply of DNB Vessel and HNB3 Vessel shall include all testing jigs, flange closure plates (welded or otherwise) and fittings to allow helium leak testing at the ITER site. These may be the same items that were used for tests prior to delivery. Methodologies for the subsequent removal of such features shall also be supplied.

3.4 The supplier is responsible for all jigs, seals and equipment to allow the leak tightness to be proven across all vacuum boundaries, unless otherwise stated in the contract. Where pressure testing is required, this must always be performed prior to final vacuum leak testing.

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

- 3.5 The supplier is responsible for the design, manufacturing and supply of tooling (as needed) and methodologies for the subsequent removal (as required) of jigs, seals, temporary closure plates, etc., which have been fitted to components to facilitate the leak testing of such components. All specific tools (if needed), closing blank flanges, Viton® seals and welded cups required to perform the leak test shall be part of the procurement. They shall be shipped to the ITER site with the NB Vessels. This will allow IO to perform the on-site leak test. If tools are necessary to perform the leak tests, the loads generated by the tools necessary for the leak test on the NB Vessels shall be checked by calculation. The calculation reports and results shall be provided by INDIA during the MRR.
- 3.6 The leak test method shall be agreed in advance with ITER-India and IO. This will involve the submission for approval of a procedure. The procedure should describe how the leak test will be performed, and include configuration diagrams and full details of the equipment to be used etc.
- 3.7 In addition to ITER-India representative, the ITER Vacuum Responsible Officer (RO) will nominate a Vacuum Specialist to witness the acceptance leak tests and any other leak test deemed necessary as part of a manufacturing process.
- 3.8 The requirement to leak test proprietary components delivered to the ITER site with a supplier's Certificate of Compliance may be waived by ITER at the discretion of the ITER Vacuum RO.
- 3.9 Clean Conditions:
- Before leak testing, components shall be cleaned, dried or baked in accordance with **Annexure 7** of the specification. At the beginning of the test, the component shall be temporarily extracted from the protection set up after the cleaning. The test shall anyway be carried out in clean conditions. At the end of the test, the component shall be protected again as prescribed in **Annexure 7 of** this specification unless the subsequent test is performed right after.
4. **Certification of personnel**
- The Examination shall be performed by suitable trained and experienced personnel.
5. **Choice of Units**
- The measured leak shall be reported in SI units. i.e Pascal cubic meter per second (Pa.m³/s).

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB Annexure 10: Leak testing	INDUS Ref No II-6L5NDXI- v1.1
---	---	--

6. Sensitivity of He detector

Minimum 10^{-10} Pa.m³/s

7. Maximum Acceptance Leak Rates

HNB3 BLV: The maximum acceptable leak rate (from exterior atmosphere to internal vacuum) shall be less than 2×10^{-9} Pam³/s air equivalent

HNB3 BSV: The maximum acceptable leak rate (from exterior atmosphere to internal vacuum) shall be less than 2×10^{-9} Pam³/s air equivalent.

HNB3 Feedthrough box: The maximum acceptable leak rate (from exterior atmosphere to internal vacuum) shall be less than 1×10^{-9} Pam³/s air equivalent

DNB Vessel: The maximum acceptable leak rate (from exterior atmosphere to internal vacuum) shall be less than 2×10^{-9} Pam³/s air equivalent

DNB Feedthrough box: The maximum acceptable leak rate (from exterior atmosphere to internal vacuum) shall be less than 1×10^{-9} Pam³/s air equivalent

Helium equivalent Leak Rate (LR) = Air equivalent x 2.69 at the same temperature.

$$\frac{LR_{Helium}}{LR_{Air}} = \frac{\sqrt{M_{Air}}}{\sqrt{M_{Helium}}} = 2.69 \quad (M = \text{atomic mass})$$

8. Scheduling of Leak Tests

Prior to manufacture the supplier shall have an accepted leak test plan detailing the timing and type of tests to be performed during manufacture. The plan shall include which tests are to be witnessed by the ITER-India or IO Vacuum Specialist.


The ITER Vacuum RO shall be informed a minimum of two weeks in advance of a test requiring witnessing by IO.

Scheduling of leak testing shall be in compliance with the ITER Leak Testing Policy (ITER_D_L5P5P2).

100% of vacuum sealing welds shall be subject to helium leak testing in accordance with the requirements and procedures of this annexure.

Where multi-pass welding is required in the production of components of VQC 1A, it is recommended that leak testing of the root weld pass shall be performed with only this pass completed.

All repaired vacuum boundary welds shall be subject to full vacuum leak testing with the same procedure and acceptance criteria as that of original weld.


	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB Annexure 10: Leak testing	INDUS Ref No II-6L5NDXI-v1.1
---	--	------------------------------

Final assemblies must be tested before shipping to ITER as per Annexure 2_QA, QC, Inspection and testing

Leak testing to be performed at ITER site is not in the scope of present tender.

9. Methods and Procedures

- 9.1 The leak test procedure for acceptance tests shall be accepted in advance by the ITER-India and ITER vacuum RO. The procedure shall describe how the leak test will be performed, and include configuration diagrams and full details of the equipment to be used. For each test, a document must be prepared showing the mechanical set-up, the number of the assembly, base pressure, calibration & measured leak-rate.
- 9.2 Guidance on acceptable methods of carrying out leak testing is given in clause 10 of this annexure. These are recommended procedures for carrying out the most widely used methods of helium leak testing; it does not consider all available methods. Other methods may be used, but only with the prior approval of the ITER-India and ITER Vacuum RO
- 9.3 The acceptance leak test method shall ensure leak tightness is proven across all vacuum boundaries.
- 9.4 Test conditions (pressure, temperature) for the acceptance leak test shall be as close as practical to the design conditions. Testing shall be carried out with the component at ambient temperature. The direction of the pressure differential shall normally be in the same direction as during operation exhibited by the components. Exceptions will be considered for the larger ITER components for tests prior to the final commissioning tests.
- 9.5 For an acceptance helium leak test, the helium concentration around the test piece shall be at a minimum of 50% for the duration of the test. The helium concentration shall be measured and recorded. The helium shall be maintained for a period calculated to be sufficient to identify leaks at the acceptance level.
- 9.6 A representative of the ITER Organisation may inspect the supplier's leak testing equipment and witness a proof of procedure prior to the acceptance leak test.
- 9.7 Acceptance leak tests shall be witnessed or, where there are many tests agreed to form the acceptance leak testing, a representative sample of the test shall be witnessed. The ITER Vacuum RO shall nominate or approve the Vacuum Specialist to witness the acceptance leak tests. ITER may require that other key (ITER_D_L5P5P2) leak tests to be implemented as part of a manufacturing process be witnessed. Those tests to be witnessed by ITER, including the acceptance tests, shall be defined in the Manufacturing Inspection Plan (MIP).

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI-v1.1
---	---	------------------------------

10. Leak testing Methodologies

Following are the recommended procedures for carrying out the most widely used methods of helium leak testing; it does not consider all available methods. Other methods may be used, but only with the prior approval of the ITER-India and ITER Vacuum RO

10.1 Over Pressure Methods

Over-pressure methods enable thin-walled vacuum chambers to be leak tested which might otherwise collapse under vacuum. This method is also useful when the equipment to be tested is already filled with a gas which can be used as the test gas. However, the test gas which flows out through any leaks always mixes with contaminants present in the air, and this might reduce sensitivity.

10.1.1 Mass Spectrometer Sniffing Probe

Helium, or some other suitable gas, is used to slightly pressurise the component to be tested and a sampling probe “sniffs” for leaks. Helium passing through the leak is sampled from the surrounding atmosphere through a long narrow flexible tube which is connected to a mechanical pump to give a drop in pressure from atmosphere to about 10^{-2} Pa at the ion source of a mass spectrometer detector. Traces of helium or halogen in the environment can also be detected, which may lead to errors in the measured leak rate.


The helium content of atmospheric air limits the sensitivity of the sampling probe, and the detection limit is typically $\sim 1 \times 10^{-7}$ Pa m³ s⁻¹ if the volume is filled with pure helium (or the tracer gas appropriate for the detector used such as argon).

The sampling tube should be as short as possible to reduce the response time of the gas flow of the air-helium mixture from the entrance of the tube to the detector. The flow rate may also be limited by the available pumping throughput.

10.1.2 Probe Leak Testing (vacuum box or suction cup method)

Open objects can be tested using the vacuum box or suction cup method. A partial enclosure which can be evacuated by a leak detector is tightly pressed against the wall of the component being tested. The enclosure is evacuated and helium tracer gas applied to the opposite surface of the wall by a spray gun or other means. Helium leaking through the wall can pass to the detector via the vacuum box. This method of leak detection is widely used for the testing of welds on incomplete enclosures. The sensitivity is usually limited by diffusion of helium through the seal between the evacuated enclosure and the component wall.

10.1.3 Pressurisation – Evacuation (“bombing”) Test

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

Hermetically sealed objects which cannot be pumped out can be leak tested using the so-called “bombing” method. The component to be tested is subjected to a high pressure of tracer gas, usually helium, to force gas into the component through any leaks present. After flushing to remove adsorbed tracer gas from the surface of the component, it is placed in a vacuum chamber which is connected to a leak detector.

This can then detect any tracer gas passing out of the sealed volume through the leaks. This method is usually employed as a “go/no go” test since it is very difficult to locate the position of any leaks on such components.

10.2 Vacuum Leak Detection Methods

10.2.1 Pressure Rise Test

A pressure rise test is a useful way of determining the overall magnitude of any leaks present in a component.

A vessel to be tested of volume V is evacuated and sealed off. The pressure rise ΔP is measured over a time interval Δt and the leak rate q_L (at constant temperature) is evaluated from:

$$q_L = V \cdot \frac{\Delta P}{\Delta t}$$


This calculated leak rate also includes contributions from any other gas sources such as virtual leak and outgassing.

Real leaks may be distinguished from other sources of pressure rise since a real leak gives a pressure rise which is strictly proportional to time, while virtual leaks and outgassing result in an initially rapid pressure rise which tends to level off after some time

10.2.2 Helium Leak Detectors

These are based on a mass spectrometer, usually a small magnetic sector device. Leak detection can begin only when high vacuum conditions are obtained in the mass spectrometer. Due to its high sensitivity this method is the most frequently used method of leak detection for vacuum applications. The inlet pressure at the entrance to the leak detector depends on the design of the unit, but can range from atmosphere down to about 10^{-4} Pa.

Helium is usually used as the tracer gas, but other gases such as argon, neon, krypton, hydrogen and mixed gases may be used with the mass analyser suitably tuned. Modern

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB Annexure 10: Leak testing	INDUS Ref No II-6L5NDXI-v1.1
---	--	------------------------------

helium leak detectors are usually supplied with the capability of detecting H_2 , He^3 , and He^4 .

To increase the helium detection sensitivity and improve detector stability, the mass analyser in helium leak detection systems is often de-tuned to give lower mass resolution. This can lead to a contribution to the measured mass 4 intensity from mass 2 and mass 3, thus giving a higher leak detector background signal at mass 4. For large component leak testing at high sensitivity, it may be necessary to reduce the partial pressure of hydrogen at the analyser by selectively pumping it with a getter in series with the leak detector input. It may also be necessary to selectively pump condensable gasses at the leak detector inlet. This can be achieved by the addition of a cold (e.g. liquid nitrogen) trap in series with the inlet.

11. Procedure for Helium Leak Tightness and Testing

11.1 Equipment

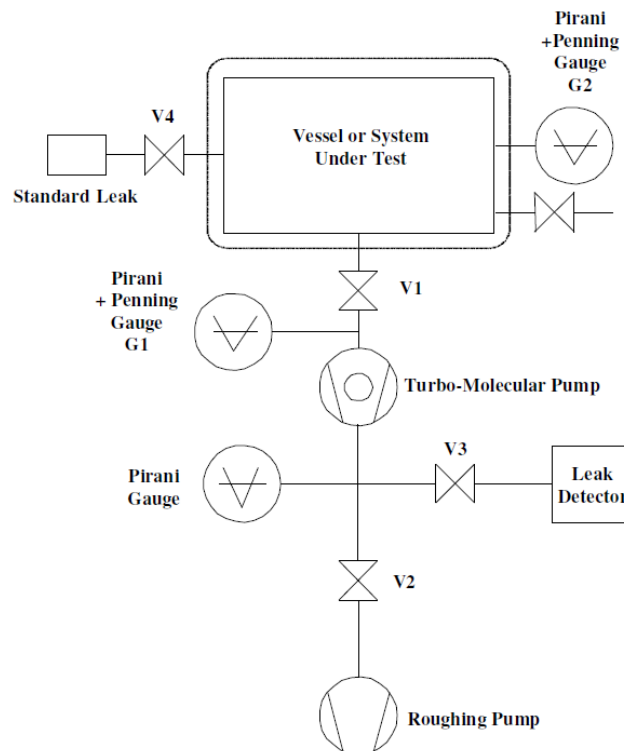



Figure-1: Typical Leak Detection Equipment

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

11.2 Pumping System

An indication of the basic elements of a pumping system, which could be used for leak detection, is illustrated in Figure-1 . In this form it consists of the following items: -

1. A turbo-molecular pump isolated by a valve V1 and backed by a roughing pump via a valve V2, of enough pumping capacity to pump the system under test down to a suitable pressure at the inlet of the leak detector. Ideally all fittings and seals (at least those on the high vacuum side) should be all-metal to alleviate the problem of helium permeation.
2. A Pirani gauge to measure the pressure in the backing line of the turbo-molecular pump and a pressure gauge system (G1) on the high vacuum side of the turbomolecular pump (but below valve V1) capable of measuring in the range 0.1 MPa to 10^{-7} Pa.

Possible additional options to this pumping system could include a quadrupole or other type of mass spectrometer to measure the residual gas spectrum. This is essential if system cleanliness is to be assessed. A hydrogen getter and liquid nitrogen trap may be used to lower the detector background signal.

A vent valve on the vessel side of V1 is also advisable for venting the item under test to a clean dry gas such as nitrogen to retain cleanliness.


11.2.1 Detection System

This is the system used to detect any vacuum leaks which may be present, thus it is the central part of the system and normally consists of the following items:

1. A helium mass spectrometer leak detector installed such that it can be connected into the backing line of the turbo-molecular pump through valve V3. For maximum leak detection sensitivity, it should provide the necessary backing pressure for the turbo-molecular pump. It therefore should have its own pumping system comprising a turbo-molecular and backing pump combination. It must be able to detect leaks at least one order of magnitude smaller than that required by the specification of the item under test, and up to at least $100 \text{ Pa m}^3 \text{ s}^{-1}$.

It should be noted that with modern leak detectors, it is possible to suppress the background and gain up to 2 orders of magnitude in sensitivity. Although this mode is useful in localising leaks, it shall not be used for the purpose of acceptance testing without prior approval by the ITER Vacuum RO.

An alternative when the item under test is of relatively small volume of less than 1 m^3 , and when only a simple cold leak test is required, is to use the mass

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

spectrometer leak detector on its own. In this case the leak detector is connected directly to the item under test. The separate turbo-molecular and roughing pump system is not required.

If there is a large leak on the item to be tested or where the pumping system is incapable of pumping the item under test to a sufficiently low pressure for the leak detector to be connected directly to the backing line of the turbo molecular pump, valve V2 may be left open and valve V3 partially opened so that the leak detector samples part of the gas stream to the backing pump. This configuration may be used to locate, but not size, any leaks.


2. A pressure gauge system (G2) on the vessel under test, capable of measuring in the range 0.1 MPa to 10^{-7} Pa.
3. A calibrated helium standard leak of value commensurate with the magnitude of leak rate required by the specification of the item under test, mounted on the system under test, and isolated by valve V4. Traceable calibration certificates shall be kept for this item and these should be readily available.
4. A helium bag or other enclosure fashioned in such a way that the test gas can surround all parts of the item under test with a concentration preferably exceeding 50% in air.
5. A system for continuous recording of the leak test process. This can be achieved by using an analogue recording device such as a paper strip chart recorder connected to the output of the helium mass spectrometer leak detector or by continuous logging (and display) of data on a computer or dedicated data logger.

11.2.2 Miscellaneous

The following equipment is optional but experience has shown the items to be of use in helium leak tests.

1. A standard vacuum cleaner to pump the helium enclosure out if it is a sealed collapsible type such as a plastic bag before inflating it with helium, to ensure maximum concentration of the helium in the enclosure.
2. A helium-in-air concentration monitor to ascertain the percentage of helium in the bag or other enclosure during the test.
3. A triggered helium spray gun for subsequent probe testing of the item to localize any leaks found during the global leak test.

11.3 Preliminaries

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

11.3.1 Initial Checks on the Leak Detection System


1. With valve V2 open and valves V1 and V3 closed, the roughing pump is started. When the pressure falls to a suitable level, the turbomolecular pump is started and left until the pressure on gauge G1 stabilises.
2. The leak detector is switched on and when it is ready, an internal calibration is carried out as per the manufacturer's instructions.
3. The backing line Pirani gauge pressure reading is noted and valve V3 is carefully opened so that the leak detector does not trip out. (Most modern leak detectors can cope with this.)
4. The roughing pump valve V2 is closed.
5. When a relatively stable reading has been obtained on the leak detector, a leak check is carried out, by using a helium gun to probe with helium gas all joints and welds up to and including the pumped sides of V1 and V3.
6. If any leaks are found of magnitude greater than one decade smaller than the maximum leak rate called for in the specification of the item under test, then these shall be rectified and this sequence repeated until no such leaks are found.

11.3.2 Pump-down

Before the leak test can be undertaken, the item under test must be pumped down to the requisite pressure. In the case of the system shown in Figure-1 which uses a turbo-molecular and roughing pump set, the following actions shall be performed.

1. The roughing pump is started and valves V1 and V2 are opened.
2. When the system Pirani pressure reaches the level given in the manufacturer's instructions the turbo-molecular pump is started.
3. The system is ready for initial tests when the pressure reaches 10^{-3} Pa or lower on G1, or such other pressure specified as suitable by the manufacturer of the leak detector. If it does not reach this pressure, then there may be a large leak present which must be located and rectified. It should be located using either an overpressure technique as described in Clause 10.1.1 of this section **12.3.1.1** or the procedures of Clause **11.5.2** of this section but with valve V3 only partially opened so that the pressure at the inlet of the leak detector remains below the upper pressure limit specified by the manufacturer with the gas flowing to the roughing pump being sampled into the leak detector.

11.3.3 Background Determination

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

After a stable pressure reading has been obtained on gauge G2 with valves V1 and V2 open and the turbomolecular pump set running normally, with the leak detector fully functioning and the data logging device connected and operating, then the roughing valve V2 is closed and the leak detector valve V3 opened.

The leak detector reading is monitored until it has stabilised, without any electronic correction. This should take around 10 minutes, but the time can be longer depending on the size of the system under test.

This reading is recorded as the background level. Any reading above this value during the overall test constitutes a positive indication of a leak.

11.4 Leak Detector Calibration

With the system in the state as above for background determination, leak detector calibration shall be performed.


Valve V4 is carefully opened and the reading on the leak detector monitored until it is stable. This should correspond to the value of the standard leak to within $\pm 5\%$ after suitable corrections for the age of the standard leak and its temperature have been applied.

If a response time measurement is not required, then V4 is closed and the reading should then return to the background level.

11.4.1 Response and Cleanup Time Measurement

This should be done for a large system or where there is a long path length involving small bore tubes. This ensures that the duration of the overall test will be valid.

1. With the standard leak open to the system and the leak indication stable at the value of the standard leak, suitably corrected for age and temperature, valve V4 is closed.
2. The time taken for the reading on the leak detector to return to the background level is recorded. This is the cleanup time for the system and will depend on the applied pumping speed for helium and the configuration of the system under test.
3. When the background level has been attained, valve V4 is opened and the time taken to return to the level of the standard leak indication, suitably corrected, is recorded. This is the response time for the system.
4. Valve V4 is closed and the system is allowed to return to the background level.

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

5. This concludes the initial set-up tests and the overall leak test may then be undertaken.

11.5 Cold Leak Tests

11.5.1 Global Leak Check

If all the preceding conditions have been met with all equipment functioning and ready for use, a global cold leak test may be carried out according to the following procedure.


1. The data recording system is connected to the output of the leak detector and started and the date and time are recorded.
2. Valves V1 and V3 are opened and valves V2 and V4 are closed.
3. When the background reading is stable and is at a level consistent with the leak specification of the item under test, which will be for most purposes at least an order of magnitude lower than the specified maximum leak rate of the component under test and without electronic correction, the global leak check may be started.
4. The component under test is surrounded by a suitable helium enclosure. If the helium enclosure is a flexible type, it should have as small a volume as possible.

The enclosure is filled with helium to a concentration of at least 50% in air and the time is recorded in the data log

5. Helium should remain in contact with the item under test for at least 10 minutes or longer, depending on the size of the object and the response time previously measured, or for the time specified in the test specification for the component under test, whichever is longer.

In the case of components where there might be possible low conductance leak paths, for example porosity, the time required for a sensible test may be significantly longer than the response time measured for the system using the techniques of Section 12.4.4.1. Details of the method and time of duration of helium application shall be included in the leak testing procedure to be accepted by the ITER Vacuum Responsible Officer.

6. Where the helium enclosure is not completely sealed, then suitable precautions shall be taken to ensure that helium cannot back-diffuse through the roughing pumps and/or the leak detector pumps into the mass spectrometer detector. In the case of long-duration global tests, it may be advisable to house these items in a separate enclosure held at a small positive pressure above atmosphere.

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

7. After the appropriate time interval, the helium supply is closed off (where appropriate), and the enclosure vented to atmospheric air and removed. The time is recorded in the data log.

8. If the leak rate indication on the leak detector has not risen by more than the specified maximum leak rate at any time during this test procedure, the item under test shall be deemed to have passed, subject to the requirements of **Clause 11.5.3** of this section

9. It may be advisable to recheck the background reading and leak detector calibration if the global test has been of significant duration. When that has been done according to the procedures of **11.3.3 and 11.4 of this section**, then the global leak test is complete.

10. Valves V1 and V3 are closed and valve V2 opened.

11. The item is vented, or left under vacuum for further work as required.

12. If the leak rate reading during the test has at any time exceeded the specification value, then the item has failed the test, and the leaks shall be located using the procedures of clause **11.5.2**.

11.5.2 Probe Tests

These are necessary to locate any leaks greater than the value in the specification of the component being tested which may have been indicated during the global test. They may be required not only at this stage, but may be needed also after the hot global test and the final cold global test, if those two tests are required as part of the contract or other instruction.

The following procedure shall be used, although others are possible and may be used after prior agreement.


1. Any helium enclosure or other covering or obstruction is removed from the item under test wherever possible.

2. If the component under test is at cryogenic temperatures, it may have to be warmed to ambient temperature before probe tests can be carried out.

3. Valves V1 and V3 should be open and valves V2 and V4 should be closed.

4. In the case of a large item, the data logging system shall continuously record the leak detector signal so that any longer term variations in leak rate may be observed.

5. Using a helium gun, helium gas is sprayed over or into all suspect locations and under any non-removable coverings, starting at the top of the item under test and working down as required. The helium spray should be introduced to the area under test for a time

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	-------------------------------------

period consistent with the response time of the system measured in accordance with clause 11.4.1

6. If a leak indication is found, then the point of maximum reading shall be localised. For subsequent testing to localise any other leaks, it is advisable to blanket that point with a physical barrier such as a polythene bag or sheet or with a stream of another gas whilst checking the remainder of the system.


7. When all detectable leaks have been located, then the leak detector is isolated by closing valve V3. Valve V1 is closed and the item under test shall be vented to dry itrogen or clean dry air admitted through the vent valve. The ITER Vacuum Responsible Officer shall be contacted to agree a procedure to rectify the leak or leaks.

8. When any agreed repair has been successfully accomplished, the process starting from stage 11.3.2 and to point 10 at the end of stage 11.5.1 is repeated until the item is proved to meet the relevant specification.

12. Acceptance Criteria

If all the stages above have been successfully completed, then the item under test may be accepted by the ITER Vacuum Specialist as having met the relevant specification provided that the following conditions have been met.

1. The leak detector has been correctly calibrated and its calibration value is within $\pm 5\%$ of the standard leak rate value as corrected for the ambient temperature and the age of that item and that standard leak rate value is commensurate with the value of the maximum leak rate specified for the item under test.
2. The background level of the leak test was below the acceptance leak rate without electronic correction prior to the test.
3. The leak test has been performed by suitably qualified and experienced personnel to the accepted procedure, with no significant deviation from that procedure and has been witnessed by the ITER Vacuum Specialist.
4. The leak rate value as measured by the leak detector has not increased in value above the measured background to a value greater than the specified leak rate during the entire duration of the global leak test.
5. The helium concentration around the test piece shall be at a minimum of 50% for the duration of the test. The helium concentration shall be measured and recorded. The helium shall be maintained for a period calculated to be sufficient to identify leaks at the acceptance level.

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

6. The test has been performed to the agreed procedure and, where specified in the Quality Plan, has been witnessed by the ITER Vacuum Specialist.

The location and magnitude of all identified leaks shall be recorded. Normally, all practicable efforts shall be made by means agreed with the ITER Vacuum Responsible Officer to reduce any leak discovered during the manufacturing phase to a level lower than the limit of detection of the leak detection method used for the tests.

13. Responsibilities

It shall be the responsibility of the supplier to ensure that all vacuum leak tests carried out off-site and of the ITER Vacuum Responsible Officer when such tests are carried out on-site that they be performed in accordance with the contract or other specification. All deviations from such specification or agreed variation thereof shall require a nonconformance to be raised covering each specific case. In the case of any particular component, a nominated ITER Vacuum Specialist may witness the tests.

All records as detailed in the following section shall be completed and shall become part of the final document package for the component concerned.

14. Acceptance Leak Testing at the Supplier's Premises

The supplier is responsible for the supply of all testing equipment, vacuum components, all testing jigs, flange closure plates (welded or otherwise) and fittings to allow an acceptance helium leak test to be carried out.

No repair or re-work of the components (with the exception of simple tightening of flange joints or replacement of gaskets) shall be undertaken without prior agreement.

Any repair or rework will require the leak test procedure to be repeated and may include a repeat leak test at the operating temperature.


No vacuum component which fails to meet the specified acceptance leak rate at the supplier's site shall be accepted for delivery to the ITER site without prior acceptance.

15. Acceptance Leak Testing at the ITER site

Not in the scope of bidder.

16. Reporting of Leak Tests

Full records of the tests carried out shall be compiled in order to maintain traceability of the leak test history of a particular item. The records shall become part of the final document package for the component concerned. Records shall include the following as minimum:

	Manufacturing, testing and supply of vacuum vessels for HNB3 (Beam Line Vessel and Beam Source Vessel) and DNB <i>Annexure 10: Leak testing</i>	INDUS Ref No II-6L5NDXI- v1.1
---	--	--

- Identification of the Manufacturer, the purchase order and equipment
- Identification of the part, weld or the area subjected to examination
- Time of Examination
- Reference approved procedures
- Surface condition and cleanliness
- Examination condition and in particular, calibration conditions
- Data records of the output of the leak detector for all the global tests specified including the standard leak calibration and response time determination. These data records shall include the date and time of all the tests as well as any other data necessary to allow a full analysis of the results, such as the start and finish of helium gas application to the item under test.
- A record of the helium concentration during the leak test.
- A record of the system total pressure and temperature during a temperature cycle as it may pinpoint the time when a leak opened up and be instrumental in the subsequent diagnosis of the leak.
- The make and model of the helium mass spectrometer leak detector used in the test.
- The nominal value of all standard leaks used, their date of calibration, ageing and temperature characteristics, and the ambient temperature(s) experienced during the tests.
- Results of all tests showing whether it was a pass or fail and if a failure, the measured leak rate and the location of the leak plus the steps taken for repair or elimination.
- The magnitude and location (if applicable) of all leaks identified during testing. This includes leaks of size lower than the acceptance criteria for which no remedial action may have been taken.
- A full record of any residual gas scans taken with appropriate time markers to identify the scans to the position in the component leak test cycle.
- Interpretation results
- Name and qualification of the inspector
- Identification of the subcontractor conducting the examination (if applicable)
- Date of examination and inspector's signature.